

TECHNICAL DATASHEET

Update: 16/12/2020

CYANO-U UNIVERSAL INSTANT ADHESIVE

Référence	EAN	Produit
854234	3660338100697	3g pipette in blister

Description

Low viscosity universal cyanoacrylate instant adhesive. Versatile and multipurpose. For the assembly of metals, plastics or elastomers requiring high tensile and/or shear strength. Also suitable for porous materials such as wood, paper, leather and fabric.

Made in Germany.

Physical properties

(a) Cyanoacrylate Monomer (Liquid):				
Base compound	Ethyl-2-cyanoacrylate			
Colour	Colourless, transparent			
Viscosity at 20°C cone-plate	40 – 80 cps			
Density at 20°C	1,04 g/cm3			
Flashpoint	85 °C			
(b) Cyanoacrylate Polymer (Polymerised):				
Traction resistance on NBR	# 65 N/cm ²			
# = Material breakage				
Shear resistance on Steel	11 - 20 N/mm²			
Temperature range	-55°C / + 95 °C			
Solubility	Acetone-Nitromethane-Ethylacetate			
Setting time (seconds)				
Metal (Steel)	20 – 50			
Plastic (ABS)	2 – 6			
Elastomer (EPDM)	1 – 3			
Wood (Beech)	40 - 60			



Instructions

The surfaces to be glued must be clean and dry. Apply one or more drops to a single surface. Apply just enough to leave a thin layer after compression. Press the pieces together and hold them firmly for a few seconds. Good contact is essential. A proper bond develops in less than a minute and maximum strength is achieved in 24 hours. Wipe off excess adhesive from the top of the container and reseal. **Spartex Activator 829218** can be used to accelerate curing, to fill large gaps, for use with inactive materials.



TECHNICAL DATASHEET

Solvent resistance

Soft City i Cototulice					
Solvent	Example	Resistance			
Alcohol	Ethanol, Methanol	+++			
Ester (aromatic)	Ethylacetate				
Ketone	Acetone,				
(aromatic)	Benzophenone				
Aliphatic	Petrol, Heptanes,				
hydrocarbon	Hexane	++			
(alkanes)					
Aromatic	Benzyl, Toluol,	++			
hydrocarbons	Xylol				
Halogenated	Methylenchloride,				
hydrocarbons	Chloroform,				
	Chlorobenzol				
Weak aqueous	Nitrite, muriatic	+++			
acid	acid, sulphuric	(if concentrated)			
	acid, phosphoric	(ii concentratea)			
Weak aqueous	sodium hydroxide	+++			
base	solution, caustic	(if concentrated)			
	potash	(Il concentrateu)			
Water		++			
Iso-propanol		+++			
Acetone					
Mineral oil		++			

Potential danger of cyanoacrylates


Use in well-ventilated areas only. Install appropriate exhaust systems in the workshop. Apply the material economically and use the dosing system whenever possible. Keep a constant relative humidity of 50 - 65%; for lower figures, polymerisation will be delayed and monomer glue fumes will appear If necessary: wear suitable, non-sucking gloves (e.g. no cotton). Keep the adhesive out of the reach of children.

Curing performance

Ambient surface moisture initiates the curing process. Handling strength is reached in a short time, and will vary based on environmental conditions, bond line gap, and other factors. Product will continue to cure for at least 24 hours before full strength and solvent resistance is developed.


Hot strength depending on temperature

on steel, in % of traction resistance

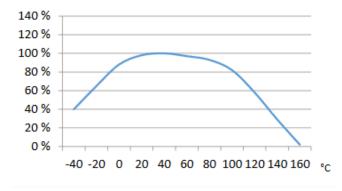

Curing through time


in % of traction resistance

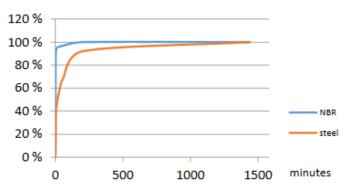


Spartex

TECHNICAL DATASHEET

Heat aging tested at 20°C in % of traction resistance

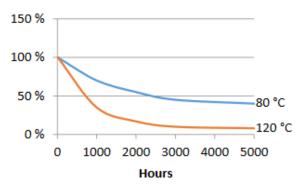


Durability after Alternating Climate Storage

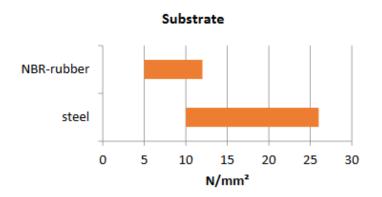

Durability after Alternating Climate Storage

tested with stainless steel

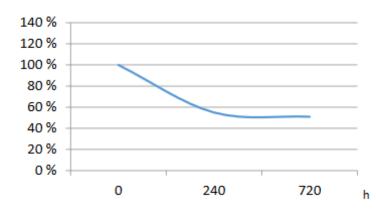

Conditions	
Temperature range	0 - 80 °C
Cycles	60
Holding time at start temperature	0 h
Heating up phase	3 h
Keeping warm phase	3 h
Cooling down phase	3 h
Holding time at final temperature	3 h

Packaging and storage

- 3g pipette in blister
- Store in a cool, dry and dark place. The storage temperature should be between 15.5 and 25 °C without direct exposure to light or heat. Do not refrigerate.

Note

The data contained in this document is provided for information purposes only and is considered reliable. Rubix Engineering cannot accept responsibility for results obtained by third parties over whose method Rubix Engineering has no control. It is the responsibility of the user to determine the suitability of the product or any production method mentioned in this document and to take the necessary precautions to protect property and persons against any risk that may be associated with its handling and use. In view of the foregoing, Rubix Engineering expressly disclaims any warranty of merchantability or fitness for a particular purpose arising from the sale or use of Spartex products. Rubix Engineering specifically disclaims any liability for consequential or incidental damages of any kind, including lost profits. We recommend that each potential user test the proposed application to determine its suitability for the intended purpose before incorporating any product or application into their manufacturing process using the data as a guide.