

# **TECHNICAL DATASHEET**

Update: 16/12/2020

## **CYANO-G ACIDIC SURFACES INSTANT ADHESIVE**

ltem #	EAN	Product
829203	366033848258	Cyano-A

## **Description**

Medium viscosity instant cyanoacrylate adhesive for acidic surfaces. Particularly suitable for wood, paper, cardboard, leather...

NSF-P1 product: adhesive suitable for use in and around food processing areas. Made in Germany.

**Physical properties** 

Thysical properties				
(a) Cyanoacrylate Monomer (Liquid):				
Base compound	Ethyl-2-cyanoacrylate			
Colour	Colourless, transparent			
Viscosity at 20°C cone-plate	90 - 180 cps			
@ 160 rpm				
Density at 20°C	1,06 g/cm3			
Flashpoint	86 °C			
Shelf life	12 months			
(b) Cyanoacrylate Polymer (Polymerised):				
Traction resistance on NBR	# 65 N/cm <sup>2</sup>			
# = Material breakage				
Shear resistance on Steel	21,0 N/mm <sup>2</sup>			
Temperature range	-55°C / + 95 °C			
Solubility	Acetone-Nitromethane-Ethylacetate			
Setting time (seconds)				
Metal (Steel)	5 – 25			
Plastic (ABS)	1 – 3			
Elastomer (EPDM)	1 – 4			
Wood (Beech)	0 - 45			





## **Standards & certifications**

- RoHS conform.
- NSF-P1 conform: adhesive suitable for use in and around food processing areas.
- ISO 10993-5: Tests for in vitro cytotoxicity (biocompatibility).

# Spartex

# **TECHNICAL DATASHEET**

#### **Instructions**

The surfaces to be glued must be clean and dry. Apply one or more drops to a single surface. Apply just enough to leave a thin layer after compression. Press the pieces together and hold them firmly for a few seconds. Good contact is essential. A proper bond develops in less than a minute and maximum strength is achieved in 24 hours. Wipe off excess adhesive from the top of the container and reseal. **Spartex Activator 829218** can be used to accelerate curing, to fill large gaps, for use with inactive materials.

#### Solvent resistance

Solvent	Example	Resistance	
Alcohol	Ethanol, Methanol	+++	
Ester (aromatic)	Ethylacetate		
Ketone	Acetone,		
(aromatic)	Benzophenone		
Aliphatic	Petrol, Heptanes,	++	
hydrocarbon (alkanes)	Hexane	++	
Aromatic	Benzyl, Toluol,	++	
hydrocarbons	Xylol	++	
Halogenated	Methylenchloride,		
hydrocarbons	Chloroform,		
	Chlorobenzol		
Weak aqueous	Nitrite, muriatic	+++	
acid	acid, sulphuric	( if concentrated)	
	acid, phosphoric	( Il concentrated)	
Weak aqueous	sodium hydroxide	+++	
base	solution, caustic	( if concentrated)	
	potash	( Il concentrated)	
Water		++	
Iso-propanol		+++	
Acetone			
Mineral oil		++	

### Potential danger of cyanoacrylates


Use in well-ventilated areas only. Install appropriate exhaust systems in the workshop. Apply the material economically and use the dosing system whenever possible. Keep a constant relative humidity of 50 - 65%; for lower figures, polymerisation will be delayed and monomer glue fumes will appear If necessary: wear suitable, non-sucking gloves (e.g. no cotton). Keep the adhesive out of the reach of children.

## **Curing performance**

Ambient surface moisture initiates the curing process. Handling strength is reached in a short time, and will vary based on environmental conditions, bond line gap, and other factors. Product will continue to cure for at least 24 hours before full strength and solvent resistance is developed.


# Hot strength depending on temperature

on steel, in % of traction resistance

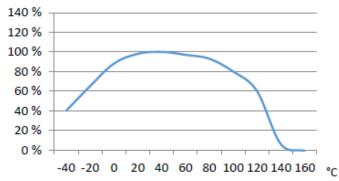

#### **Curing through time**

in % of traction resistance

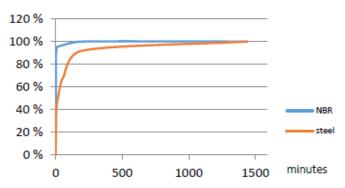


# Spartex


# **TECHNICAL DATASHEET**

### Heat aging

tested at 20°C in % of traction resistance

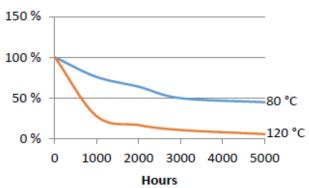


#### Adhesive resistance

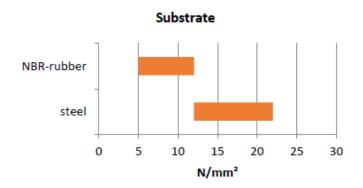

## **Durability after Alternating Climate Storage**

tested with stainless steel

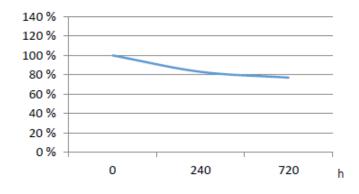

Conditions		
Temperature range	0 - 80 °C	
Cycles	60	
Holding time at start temperature	0 h	
Heating up phase	3 h	
Keeping warm phase	3 h	
Cooling down phase	3 h	
Holding time at final temperature	3 h	

## Packaging and storage

- Bottle of 20g
- The dosing tip is screwed directly onto the thread of the bottle.
- Store in a cool, dry and dark place. The storage temperature should be between 15.5 and 25 °C without direct exposure to light or heat. Do not refrigerate.

#### Note

The data contained in this document is provided for information purposes only and is considered reliable. Rubix Engineering cannot accept responsibility for results obtained by third parties over whose method Rubix Engineering has no control. It is the responsibility of the user to determine the suitability of the product or any production method mentioned in this document and to take the necessary precautions to protect property and persons against any risk that may be associated with its handling and use. In view of the foregoing, Rubix Engineering expressly disclaims any warranty of merchantability or fitness for a particular purpose arising from the sale or use of Spartex products. Rubix Engineering specifically disclaims any liability for consequential or incidental damages of any kind, including lost profits. We recommend that each potential user test the proposed application to determine its suitability for the intended purpose before incorporating any product or application into their manufacturing process using the data as a guide.