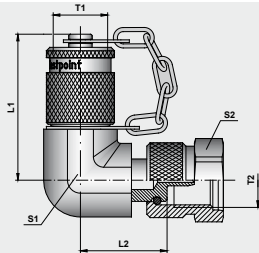
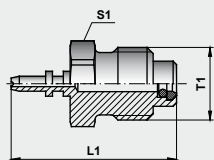
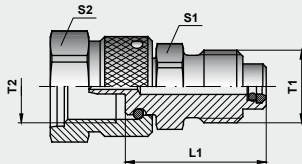
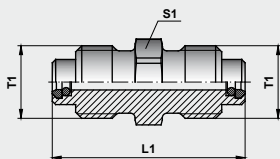
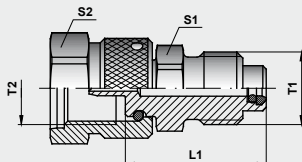
**Diagnostic adapter**

#	PN	P _{max}	P _{Berst}	T1	T2	L1	S1	S2
SCA-1/4-EMA-3	1.000 bar	1.200 bar	2.000 bar	1/4" BSPP	M16x2	32	27	22
SCA-1/2-EMA-3	630 bar	800 bar	1.200 bar	1/2" BSPP	M16x2	36	30	22
SCA-1/2-EMA-3-HP	1.000 bar	1.200 bar	2.000 bar	1/2" BSPP	M16x2	36	32	22

**90° Diagnostic adapter with coupling**

#	PN	P _{max}	P _{Berst}	T1	T2	L1	L2	S1	S2
SCA-90-EMA-3	630 bar	800 bar	1.200 bar	M16x2	M16x2	49	26	19	22

**SCA-EMA-3/1****SCA-EMA-3/2****SCA-EMA-3/3****SCA-EMA-3/4****Diagnostic couplings**

#	PN	P _{max}	P _{Berst}	T1	T2	L1	S1	S2
SCA-EMA-3/1	630 bar	800 bar	1.200 bar	M16x2	--	37	17	--
SCA-EMA-3/2	630 bar	800 bar	1.200 bar	M16x2	M12x1.65	31	17	17
SCA-EMA-3/3	630 bar	800 bar	1.200 bar	M16x2	M16x2	43	17	--
SCA-EMA-3/4	630 bar	800 bar	1.200 bar	M16x2	M16x1.5	31	17	17

**Please pay attention to pressure range!**