


EX40 / EX41

- spectrum Machine Tap
- spectrum Maschinen-Gewindebohrer
- spectrum Machinetappen
- spectrum Tarauds machine
- spectrum Machos de máquina
- spectrum Macho Máquina

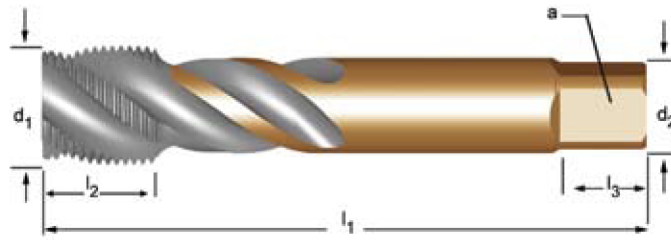

NEW

2010.09



EX40



- 1.1 1.2 1.3 1.4 1.5 7.1 7.2 7.3 7.4
- 4.1 4.2 5.1 5.2 8.1

G(BSP)	TPI	d ₁ nom mm	l ₁ mm	l ₂ mm	d ₂ Ø mm	□ a mm	l ₃ mm	z	↕	e-Code
1/8	28	9.728	90	13	7	5.5	8	3	8.8	EX401/8
1/4	19	13.157	100	15	11	9.0	12	3	11.8	EX401/4
3/8	19	16.662	100	15	12	9.0	12	4	15.25	EX403/8
1/2	14	20.955	125	18	16	12.0	15	4	19	EX401/2
5/8	14	22.911	125	18	18	14.5	17	4	21	EX405/8
3/4	14	26.441	140	20	20	16.0	19	4	24.5	EX403/4
7/8	14	30.201	150	20	22	18.0	21	4	28.25	EX407/8
1	11	33.249	160	22	25	20.0	23	4	30.75	EX401
1.1/8	11	37.897	170	22	28	22.0	25	4	35	EX401.1/8
1.1/4	11	41.910	170	22	32	24.0	27	4	39.5	EX401.1/4
1.1/2	11	47.803	190	23	36	29.0	32	4	45	EX401.1/2



NEW

2010.09



EX41



- 1.1 1.2 1.3 1.4 1.5 2.1 2.2
- 1.6 2.3

G(BSP)	TPI	d ₁ nom mm	l ₁ mm	l ₂ mm	d ₂ Ø mm	□ a mm	l ₃ mm	z	↕	e-Code
1/8	28	9.728	90	13	7	5.5	8	3	8.8	EX411/8
1/4	19	13.157	100	15	11	9.0	12	3	11.8	EX411/4
3/8	19	16.662	100	15	12	9.0	12	4	15.25	EX413/8
1/2	14	20.955	125	18	16	12.0	15	4	19	EX411/2
5/8	14	22.911	125	18	18	14.5	17	4	21	EX415/8
3/4	14	26.441	140	20	20	16.0	19	4	24.5	EX413/4
7/8	14	30.201	150	20	22	18.0	21	4	28.25	EX417/8
1	11	33.249	160	22	25	20.0	23	4	30.75	EX411
1.1/8	11	37.897	170	22	28	22.0	25	4	35	EX411.1/8
1.1/4	11	41.910	170	22	32	24.0	27	4	39.5	EX411.1/4
1.1/2	11	47.803	190	23	36	29.0	32	4	45	EX411.1/2